


| | | |
|--|------------------------|---|
| VORTAC ELP 115.2 Chan 99 | APP CRS 245° | Rwy Idg TDZE 3925 Apt Elev 3962 |
|--|------------------------|---|

VOR RWY 26L

EL PASO INTL (ELP)


| | | |
|---|------------------|--|
| ASR Inop table does not apply to S-26L and CINAG fix minimums S-26L. Circling NA for Cat D northwest of Rwy 4-22. | MALSR | MISSED APPROACH: Climb to 4500 then climbing left turn to 7100 on heading 050° and on ELP VORTAC R-081 to FEMOL INT/9 DME and hold. |
|---|------------------|--|

| | | | | |
|------------------------------|---|---------------------------------------|-------------------------------|--------------------------------|
| D-ATIS 120.0 254.3 | EL PASO APP CON 124.25 298.85 | EL PASO TOWER 118.3 239.275 | GND CON 121.9 348.6 | CLNC DEL 125.0 379.1 |
|------------------------------|---|---------------------------------------|-------------------------------|--------------------------------|

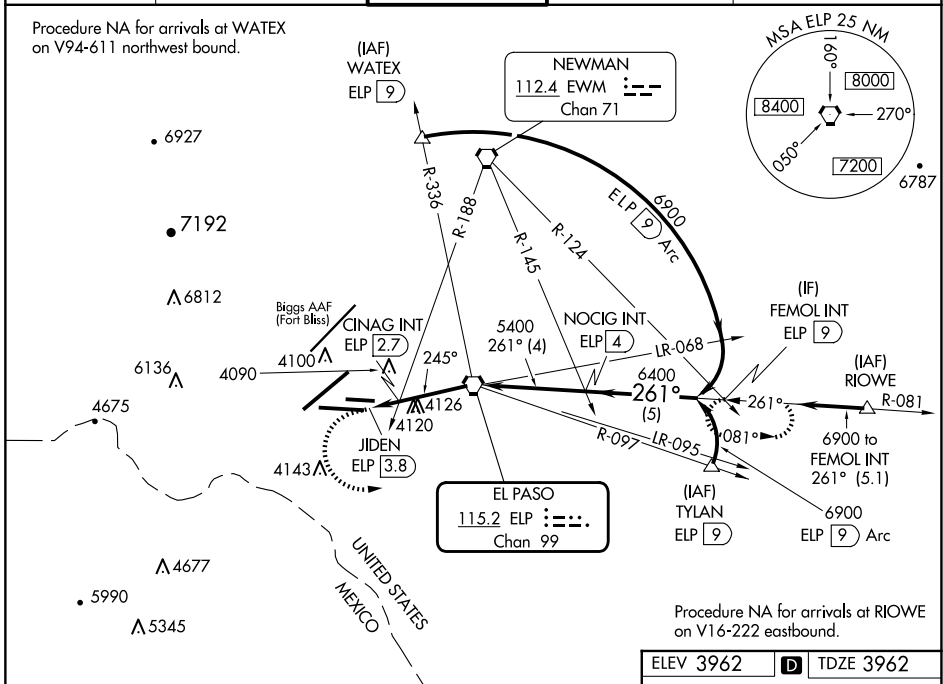


SC-3, 15 MAY 2025 to 12 JUN 2025

SC-3, 15 MAY 2025 to 12 JUN 2025

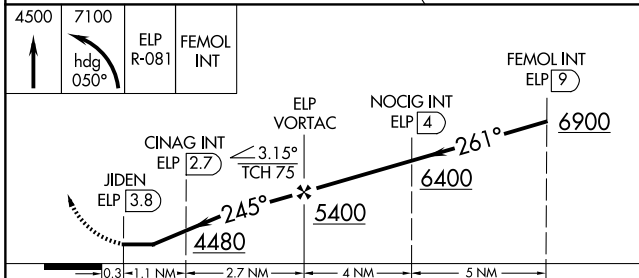

| | | |
|-----------|----------|-----------|
| ELEV 3962 | D | TDZE 3962 |
|-----------|----------|-----------|

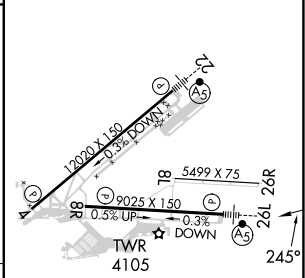

| CATEGORY | A | B | C | D | E |
|---|--------------------|--------------------|---|---|----|
| S-26L | 4480-1 518 (600-1) | | 4480-1 ³ / ₈ 518 (600-1 ³ / ₈) | | NA |
| C CIRCLING | 4480-1 518 (600-1) | | 4480-1 ¹ / ₂ 518 (600-1 ¹ / ₂) | 4680-2 718 (800-2) | NA |
| CINAG FIX MINIMUMS (DUAL VOR RECEIVERS OR DME REQUIRED) | | | | | |
| S-26L | 4380-1 418 (500-1) | | 4380-1 ¹ / ₈ 418 (500-1 ¹ / ₈) | | NA |
| C CIRCLING | 4420-1 458 (500-1) | 4440-1 478 (500-1) | 4480-1 ¹ / ₂ 518 (600-1 ¹ / ₂) | 4680-2 ¹ / ₄ 718 (800-2 ¹ / ₄) | NA |

| | |
|--------------------------|--------------------------|
| MRL Rwy 8L-26R | FAF to MAP 3.8 NM |
| REIL Rws 4 and 8R | |
| HIRL Rws 4-22 and 8R-26L | |
| Knots | 60 90 120 150 180 |
| Min:Sec | 3:48 2:32 1:54 1:31 1:16 |