

KING SALMON, ALASKA

HI-ILS Z or LOC Z RWY 12

LOC/DME I-AKN 110.3 Chan 40	APCH CRS 121°	Rwy Idg 8501 TDZE 62 Arpt Elev 73	[USAF]	KING SALMON (AKN) (PAKN)
---	-------------------------	--	--------	--------------------------

DME required. RADAR required for procedure entry.

▼ * When ALS inop. increase RVR to 40.

** When ALS inop. increase RVR to 55.

 -31° C

MALSR





MISSED APPROACH: Climb to 600, then climbing right turn to 3000 via heading 240° and AKN VORTAC R-210 to OLLER/AKN 15 DME and hold.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	TOWER ★ 118.3 279.5	GND CON 121.9	CTAF 121.9 0 352.05	UNICOM 122.95
---------------	---------------------------------	------------------------	------------------	------------------------	------------------

† When control tower closed, increase RVR to 50.

Autopilot coupled approaches not authorized below 700' MSL.

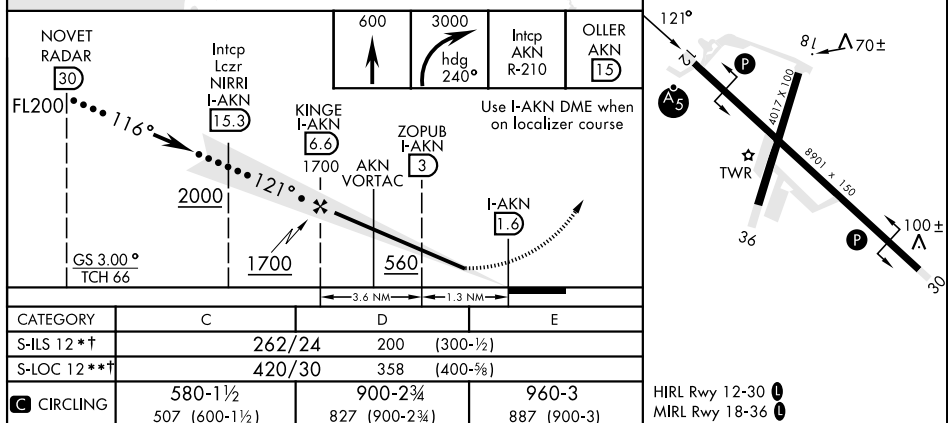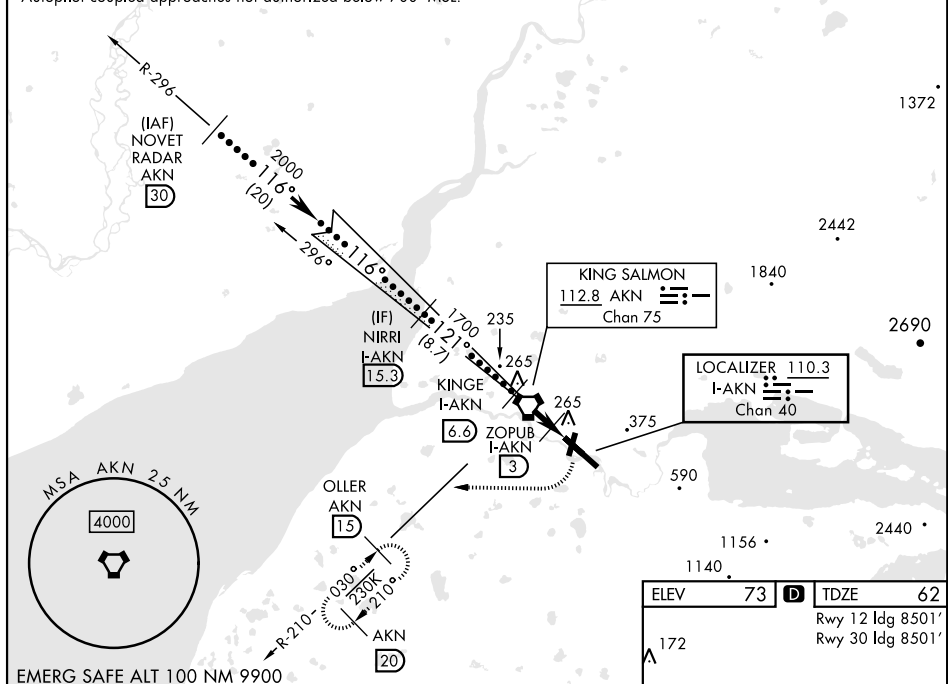

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (AKN) (PAKN)

Amdt 8 22APR21

HI-ILS Z or LOC Z RWY 12

AK, 17 APR 2025 to 12 JUN 2025